IMPERMAX POLYUREA H FLEX BRONZE

Sprayed, hot-applied polyurea waterproofing membrane




DESCRIPTION

Impermax Polyurea H Flex Bronze is a two-component polyurea resin, which cures very quickly forming a totally continuous, thermostable and elastomeric membrane with an excellent ability to bridge the possible cracks of the support. This resin can only be applied by a hot two-component spraying equipment.

Impermax Polyurea H Flex Bronze is the bronze-like metallic version of the Impermax Polyurea H Flex reference. Both references have the same mechanical properties and have the same certificates.

The only difference between the various versions with metallic finish and the rest of the colors is that the Impermax Polyurea H Flex Bronze has a higher electrical conductivity (antistatic effect) and that due to its special finish, the color remains very stable, almost without yellowing, when the membrane is exposed to sunlight. Therefore, it is not necessary to apply an aliphatic protective finish to maintain the color and aesthetic appearance.

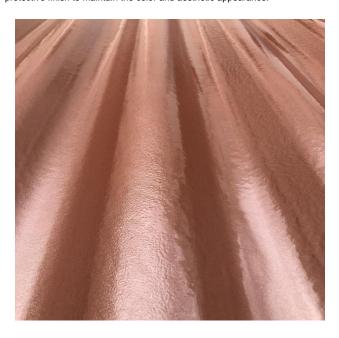

APPLICATION

Impermax Polyurea H Flex Bronze is specially designed to protect and waterproof structures exposed to the outside, mainly roofs and terraces. Its application is recommended for aesthetic reasons or in case it is considered convenient to save a step in the waterproofing process (it is not necessary to apply an aliphatic protective layer).

CERTIFICATIONS

- Fire test B2 (DIN 4102-1:1998): Ignitability when subjected to direct impingement of flame. Class B2
- ETA: European Technical Assessment document No 21/0740 (EAD 030675-00-0107) CE marking





TECHNICAL DATA

INFORMATION ON THE PRODUCT BEFORE APPLICATION			
	Component A Component B		
Chemical description	Polyol/Polyamide	Aromatic isocyanate	
		prepolymer	
Physical state	Liquid	Liquid	

Packaging	Metal container		Metal container	
	192 kg		208 kg	
	(pigmen	t added)		
Non-volatile content	Approx	(100%	100%	
Flash point	>10	0ºC	>100°C	
Colour	Bronze		Slightly yellow	
Density	Tempera	Density	Tempera	Density
	ture (°C)	(g/cm ³)	ture (°C)	(g/cm³)
	20	1.05	20	1.14
	60	1.02	60	1.10
Viscosity	Tempera	Viscosity	Tempera	Viscosity
	ture (°C)	(mPa.s)	ture (°C)	(mPa.s)
	20	975	20	800
	60	170	60	120
VOC	<2g/L, <0,2%		0	
(2004/42/CE)	A, j		A, j	
A/B mixing ratio	A=1, B=1.08 by weight			
	A=1, B=1 by volume			
Density and viscosity	Fast polymerization. See Pot life data.			
of the mixture				
Pot life	Gel time mixture A+B (20 g)			
	8-9 s at 25°C			
	4-6 s at 60°C			
Storage	Keep between 10° y 30°C. Product is hygroscopic:			
	protect from moisture. Component B may become			
	hazy upon storage at low temperatures. Reheat			
	mildly before use.			
Use before	12 months after manufacture, provided it is kept in			
	its sealed container.			

INFO	MATION ON THE FINAL F	PODUCT	
INFORMATION ON THE FINAL PRODUCT			
Final state	Solid elastomeric membrane		
Colour	Metallic reddish appearance (Bronze color)		
Hardness (Shore)	90A/40D (ISO 868)		
Mechanical	Elongation at break: 400%		
properties	Tensile strength: 14 MPa		
	(EN-ISO 527-3)		
Chemical	Permanent contact (7 days, 80°C 0=worst, 5=best)		
resistance			
	Chemical	Result	
	Water	5	
	Ammonia (3%)	5	
	Hydrochloric acid 3M	4	
	(9%)		
	Isopropyl alcohol	1	
	Xylene	0	
	Sulphuric acid (50%)	0	
Adhesion	Substrate	Adhesion strength	
strength		(Mpa)	

strength	(Mpa)		
	Concrete (EP 100	5.6	
	primer)		
	Steel (PU primer)	3.6	
UV resistance	Good resistance to UV-induced degradation. Excellent		
	gloss and color retention when	nen exposed to sunlight.	
Fire resistance	Class B2		
Tear strength	69 N/mm (ISO 34-1 Method B)		

SUPPORT REQUIREMENTS

In order to achieve a good penetration and bonding, support must be:

1.Flat and levelled

2. Compact and cohesive (pull off test must show a minimum resistance of 1,4 N/mm²).



KRYPTON CHEMICAL SL

C/ Martí i Franquès, 12 - Pol. Ind. les Tàpies 43890 - l'Hospitalet de l'Infant - Spain Tel: +34 977 822 245 - Fax: +34 977 823 977 www.kryptonchemical.com - rayston@kryptonchemical.com

Latest update: 05/08/2024

Page: 1/3

IMPERMAX POLYUREA H FLEX BRONZE

Sprayed, hot-applied polyurea waterproofing membrane



- 3. Even and regular surface
- 4. Free from cracks and fissures. If any, they must be previously repaired.
- 5. Clean and dry, free of dust, loose particles, oils, organic residues or laitance.

RECOMMENDED ENVIRONMENTAL CONDITIONS

Air temperature should be between 10°c and 40°C . Relative air humidity should be less than 85%.

SUPPORT PREPARATION

Concrete substrates must be prepared mechanically using high pressure sand or abrasion, to remove the surface and obtain an open pore. Substrates must be primed and levelled until a regular surface is obtained. Sharp irregularities are eliminated using an abrading disc machine. Eliminate all dust and loose particles from the substrate by brushing or vacuum cleaning.

MIXING

Stir and homogenise separately both components using suitable mixing equipment before being loaded to the machine. Recommended mixing equipment should have extensive blades, width equivalent to 1/3 of drum diameter. Be sure that pigment in component A is well mixed and liquid has a homogeneous aspect before loading it into the machine. However, excess stirring may lead to undesirable moisture pick up. Recirculate both components while heating up to the required application temperatures.

APPLICATION GUIDELINES

Impermax Polyurea H Flex Bronze must be applied using a 2-component hot spraying equipment.

Recommended temperatures are:

- Component A: 65°C
- Component B: 70°C
- Hose: 65°C

Pressure should be between 135 and 170 bar. During application, check layer thickness and curing speed.

Spray Impermax Polyurea H Flex Bronze at 2 kg/m² as a rule.

Wind speeds more than 25 km/h may result in excessive loss of exotherm and interfere with the mixing efficiency of the spray gun affecting polyurea surface texture, cure, and physical properties and will cause overspray issues.

Contact Krypton Chemical for more detailed technical information

CURING TIME

Impermax Polyurea H Flex Bronze cures to touch after a few minutes after application. Approximate hardness values are provided as reference only (1 mm, polypropylene support, 25°C 50% RH).

Time	Hardness (shore A/D)
10 min	74/27
20 min	77/29
1 hr	80/30
24 hr	88/35

RE-APPLICATION

Usually, needed thickness can be obtains in one single coat. If necessary, a second coat can be applied immediately afterwards. If a previous epoxy primer has been applied, apply Impermax Polyurea H Flex Bronze only on the dry primer (approximately 8 hours). To obtain a good adhesion, it is recommended to clean the previous coat applied with PU Primer.

RETURN TO SERVICE

Under most usual conditions (25° C, 50° rh), the membrane is resistant to rain droplets after 15 minutes, and able to resist light pedestrian traffic in 1 hour. After 2 days, 90% of the final properties are reached.

TOOL CLEANING

Solvent use for machine component cleaning is discouraged. A cleaning plasticizer fluid is suitable. Component B must be completely removed from all air-exposed parts and replaced with cleaning fluid.

CLEANING AND MAINTENANCE

A maintenance work must be carried out regularly on the treated roofs according to the intended use.

This work includes the following tasks:

- Leaf removal
- · Grass, dirt, moss and other vegetation removal
- Keeping storm water system in good working order.
- Ensure gratings are in place, in order to prevent gutter obstructions.
- Check proper condition of several structures (flashing, seams, retaining walls...)
- Verification of possible damages due to improper use.

If aesthetic appearance of the roof is an important issue, it is essential to regularly clean the surface with water (some mild detergent may be added), according to the use.

For stain removal, a surface treatment with Rayston solvent or isopropyl alcohol may be attempted. Strong acids are totally inadequate. Some solvents may damage the membrane. If this happens, the affected area has to be cut and repaired with a new Impermax Polyurea H Flex Bronze.

FAQ

Problem	Question	Cause	Solution
Product does	AB ratio is	Pressure	Check and correct
not cure	correct?	differences	machine operation
Bubbles or	Porous		Apply suitable primer
2000.00 0.	support?	No primer	before Impermax
open pores			Polyurea H Flex Bronze
		Too little	Apply 1 kg/m ²
No hiding	g Horizontal?	product	
power		Too little	Ensure full A+pigment
		pigment	homogenization

SAFETY

Component B contains isocyanates. Always follow the safety instructions in the Material Safety Data Sheet. As a rule, a good ventilation and/or respiratory protection is needed (combined organic vapor filters + particles) along with protective clothing. This product must be used only for the applications here described. This product is intended for industrial and professional use. It is not suitable for DIY-type applications.

ENVIRONMENTAL PRECAUTIONS

Empty containers must be handled with the same precautions as if they were full. Treat empty containers as hazardous waste and transfer them to an authorized waste manager. If the contains still have some material left, do not mix with other product with no knowledge of potentially dangerous reactions. Component A and B may be mixed on a 1/1 ratio to get an inert material, but never do it in volumes larger than 5 liters to prevent a dangerous heat evolution.

KRYPTON Equitorial Equipment

KRYPTON CHEMICAL SI

C/ Martí i Franquès, 12 - Pol. Ind. les Tàpies 43890 - l'Hospitalet de l'Infant - Spain Tel: +34 977 822 245 - Fax: +34 977 823 977 www.kryptonchemical.com - rayston@kryptonchemical.com

Latest update: 05/08/2024

Page: 2/3

IMPERMAX POLYUREA H FLEX BRONZE





OTHER INFORMATION

The information contained in this DATA SHEET, as well as our advice, both written as verbal or provided through testing, are based on our experience, and they do not constitute any product guarantee for the installer, who must consider them as simple information. We recommend to study deeply all information provided before proceeding to the use or application of any of our products, and strongly advise to conduct tests "on-site" to determine their convenience for a specific project. Our recommendations do not exempt of the obligation of installers to deeply study the right application method for these systems before use, as well as to conduct as many preliminary tests as possible should any doubt arise. The application, use and processing of our products are beyond our control, and therefore under the exclusive responsibility of the installer. In consequence, the installer will be the only responsible of any damage derived from the partial or total in-observation of our indications, and in general, of the inappropriate use or application of these materials.

This data sheet supersedes previous versions.



Latest update: 05/08/2024

Page: 3/3